# FAC-R FREQUENCY TO ANALOG CONVERTER - WITH BLUETOOTH

Ideal for converting your frequency output to analog with an easy-to-use handheld mobile device.



#### **APPLICATIONS**

The FAC-R Frequency to Analog Converter is ideal in any application when sending an analog signal to a PLC or other control system. It works with any frequency output sensor, such as flow meters, tachometers, pumps/motors, and linear or rotational encoders.

#### **FEATURES**

- Full input frequency range 0.25Hz to 5,000Hz
- Analog output signal defaults to 4-20mA and 0-10V (0-5V, 1-5V & 2-10V available through PC Toolkit or "AWL Mobile Toolkit" mobile app)
- · Excellent linearity, high temperature stability and long-term stability
- Powered by 10-28VDC
- 16-bit analog output resolution

#### **BENEFITS**

#### Setup Options

Choose from the "AWL Mobile Toolkit" application, the AW-Lake Toolkit PC software, or the local switches on the device to set your parameters.

#### Economical

This device is a much better investment than a high-speed PLC counter card and eliminates the need for a multimeter.

#### Linearizer

To improve output accuracy with some flow meters which are non-linear, a 10-point linearization table can be utilized through the Bluetooth app.

#### Wireless Hand-Held Display

Using the Bluetooth mobile app on your phone, you now have a wireless flow monitor in your hand!

#### Streamlined Setup

The Bluetooth app makes setup and scaling much easier, because no longer do you need to walk from the device to your monitoring equipment when fine-tuning your adjustments.

### **TECHNICAL SPECIFICATIONS**

### Supply Voltage Range

10-28Vdc

#### Input Frequency

0.25Hz to 5KHz, 5V to 24V max amplitude

#### **Analog Output Options**

4-20mA & O-10V - Default 0-5V, 1-5V & 2-10V - Available through PC Toolkit or "FAC Terminal" mobile app

#### Standard Max Output

+2.5% of max scaling (20.5mA/5.125V /10.25V)

#### **Error Indication**

+10% of max scaling (22mA/5.5V/11V)

# Analog Output Resolution 16 bit

Analog Output Update Time

### Ambient Temperature

25mSec minimum

-40°F to 185°F (-40°C to 85°C)

#### **ACCESSORIES**

#### Cables

USB-SERIAL-4PIN

Used to connect unit to a PC to access the Toolkit for programming and setup.





## FAC-R FREQUENCY TO ANALOG CONVERTER – WITH BLUETOOTH

Ideal for converting your frequency output to analog with an easy-to-use handheld mobile device.



#### **DIMENSIONS**

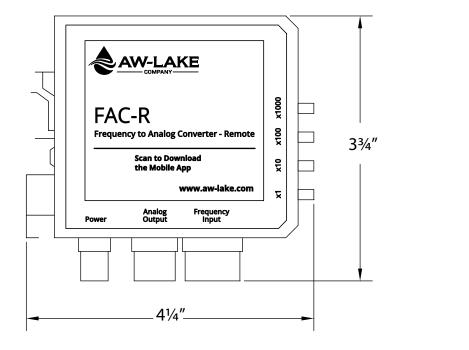



Products may be subject to change without notice - Contact factory for the most up-to-date product information.

